


2003-2005 Ford Excursion 6.0L



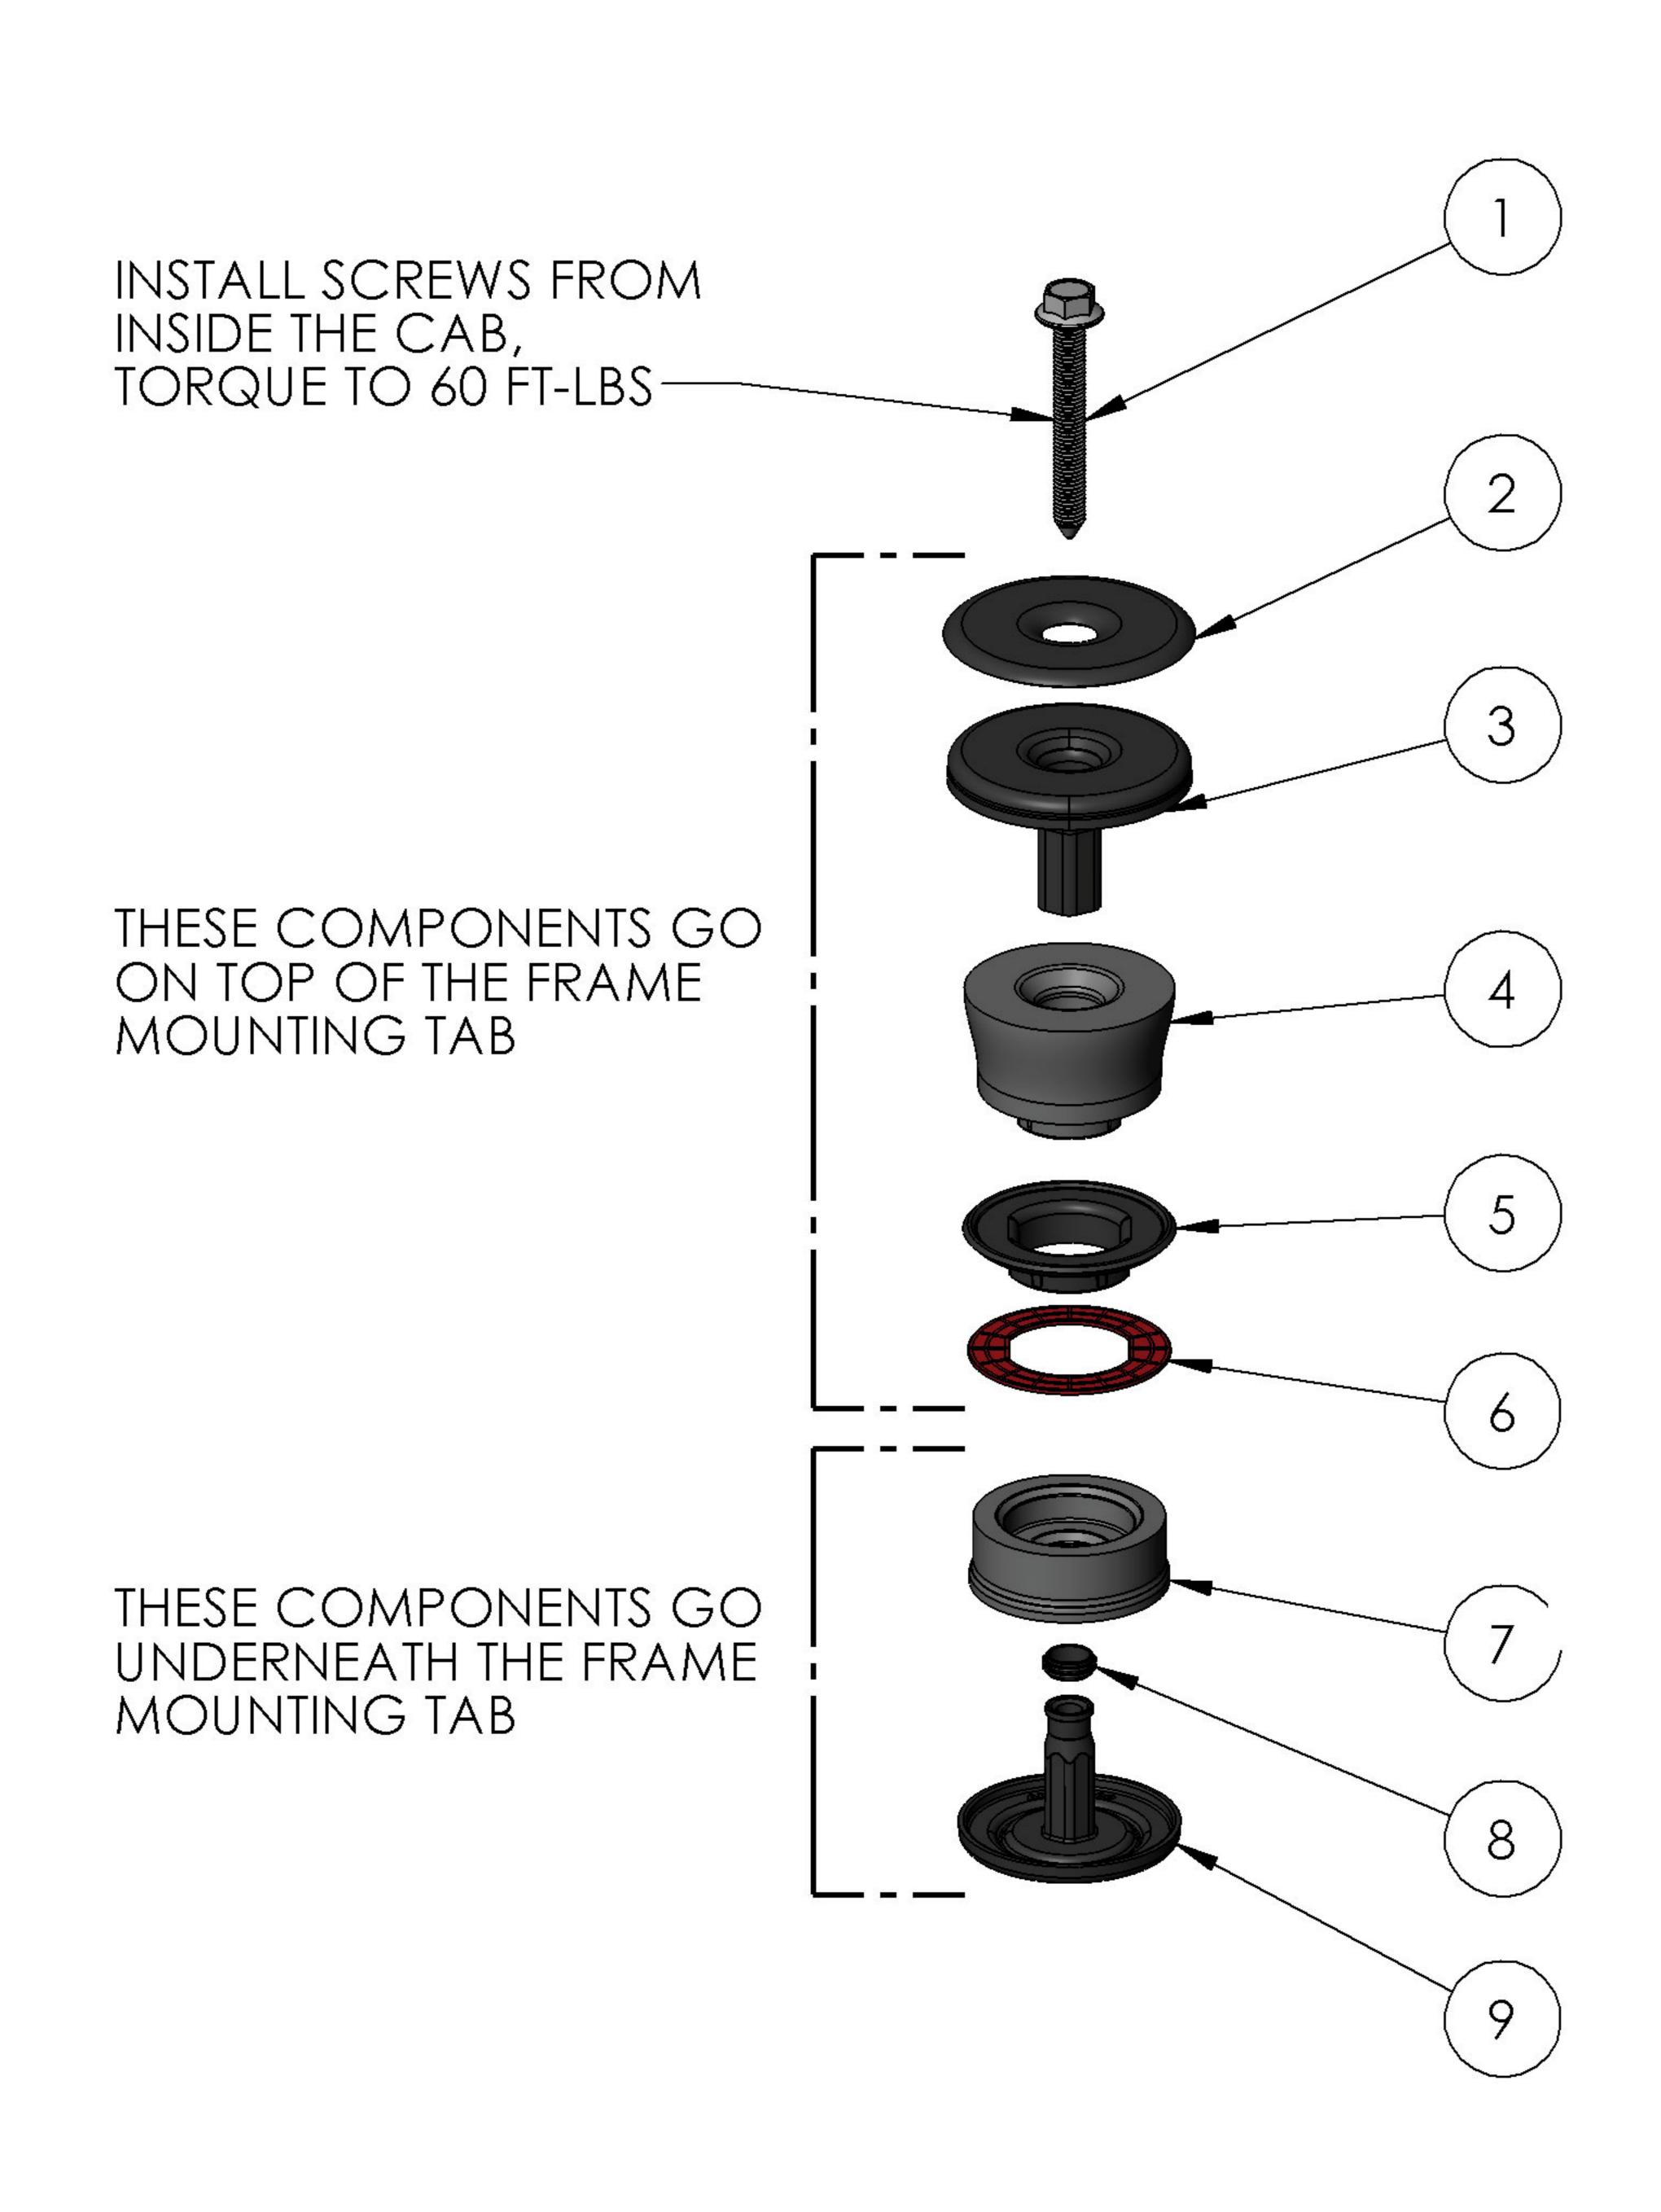

ITEM NO.	PartNo	DESCRIPTION	QTY.
1	W711305-S439 M12 X 1.75 X 95 SCREW		1
2	A 12306-00	PLASTIC SHIM	1
3	AI2186-00	UPPER CUP	1
4	AI2181C-00	UPPER ISOLATOR	1
5	AI2182-00	UPPER ISOLATOR CAP	1
6	A12305C-00	SILICONE SHIM	1
7	AI2180C-00	LOWER ISOLATOR	1
8	AI2179-00 CUP SEAL		1
9	A I2185-00	LOWER CUP	1

NOTE: THE EXCURSION KIT USES TEN (10) OF THESE ASSEMBLIES.




WARNING: Qualified professional installation of this product in accordance with the Ford service documentation and using a vehicle lift is required.


Install according to the supplied Ford Torque Spec for the best ride and to avoid damaging your truck. Do not attempt self-installation of this product or use an impact wrench at anytime. Self-installation using a jack or other lifting device could result in personal injury and/or damage to your vehicle. S&B shall not be liable for any loss, damage, including any incidental or consequential damages, fire, explosion, injury, or death as a result of self-installation of this product. The S&B Warranty will be voided if this product is not installed by a qualified professional or if an impact wrench is used.

Visit sbfilters.com for warranty and other information.

THESE COMPONENTS GO INSIDE THE ENGINE BAY




THESE COMPONENTS GO ON TOP OF THE BOXED FRAME

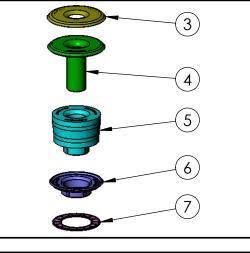

ITEM NO.	PartNo	DESCRIPTION	QTY.
1	AI2406-00	FORD N801995-S436 (M12 LOCKING NUT W/ WASHER)	1
2	Al2405-00	UPPER WASHER	1
3	AI2404-00	PLASTIC SHIM	1
4	Al2403-00	UPPER CUP	1
5	AI2399C-00	UPPER ISOLATOR	1
6	Al2400-00	PLASTIC CAP	1
7	AI2401C-00	SILICONE SHIM	1
8	AI2398C-00	LOWER ISOLATOR	1
9	Al2179-00	CUP SEAL	1
10	Al2402-00	LOWER CUP	1
11	Al2204-00	FORD W712879-S439	1

THESE COMPONENTS GO INSIDE THE BOXED FRAME

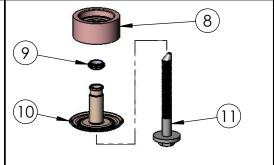

TORQUE NUT TO 60 FT-LBS.

INSTALL COMPONENTS IN THE CORRECT LOCATION ACCORDING TO THIS DIAGRAM. COMPONENTS INSTALLED INCORRECTLY WILL CAUSE CLUNKING NOISE AND MAY RESULT IN DAMAGE TO THE VEHICLE.

